


SNB008 To Suit V6 3.8 VN-VY

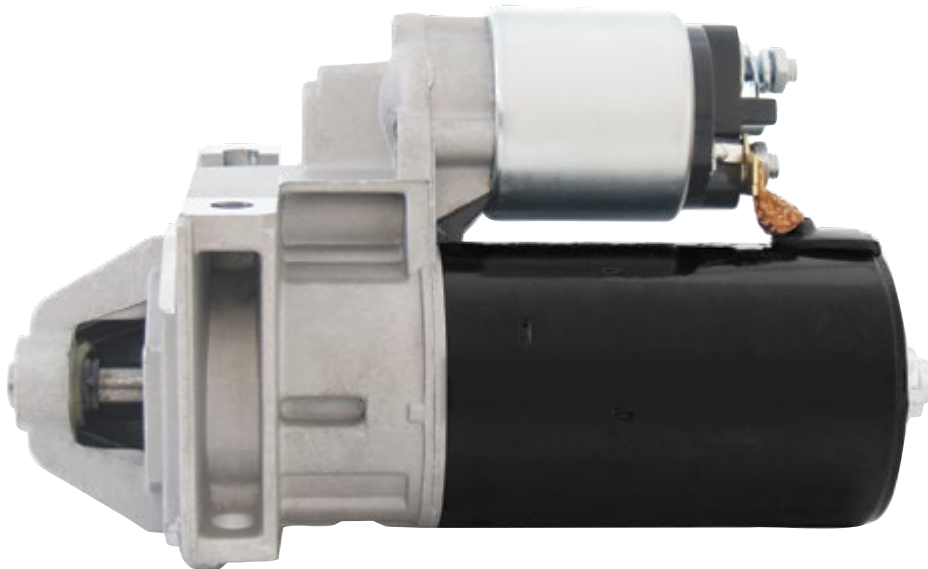

Please note that in normal operation a starter is not capable of developing enough torque to cause the drive end housing to break. Damage of this type is not covered by warranty.

This type of damage is typically caused by an engine backfire or “kickback” most likely caused by one of the following.....

- Crank Position Sensors
- Fuel Pressure Regulator
- Timing chain wear
- PCM or BCM
- Valve Adjustment
- Use of starting fluid
- Misaligned / improperly mounted starter. This starter should not require the use of shims. But correct mounting bolts are critical please refer to Tech Tip 32 on Mounting Bolts.
- For Vehicles on LPG Gas please ensure correct tuning and all air intake hoses are intact.